


Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER

GENERAL NOTES:


- MATERIAL: N/A
- FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
- PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2 E
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES 0.005 TO 0.010 MAX
- IDENTIFICATION: N/A
- WEIGHT: 20.8 LBS
- WELDING TO BE DONE PER DART QSI 004.
- ALL HOLES DRILLED ON CENTERLINES.
- DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
- DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
- COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS GREASE WITH WASH 'N WIPE DEGREASER.

RELEASED
 13/5/14
 ECN 13-567


E	REVISE NOTE 2: FINISH NOW PRIME/PAINT WAS POWDERCOAT, REF. PAR13-256	DW	13.05.17
D	NEW INSERTS, SS WEARSHOE + GASKET	CP	06.12.19
C	ADD -043; NEW INSERTS	CP	05.03.16
B	MOVE SADDLE HOLE: 42.14 WAS 42.76	CP	04.08.09
A	NEW ISSUE	CP	04.03.15
REV.	DESCRIPTION	BY	DATE
DESIGN	CP	DART AEROSPACE LTD KENT, WA	
DRAWN	DW		
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	DD	D3274	SHEET 1 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SKIDTUBE ASSEMBLY	NTS
DATE	13.05.17	COPYRIGHT ©2004 BY DART AEROSPACE USA, LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, LTD.</small>	

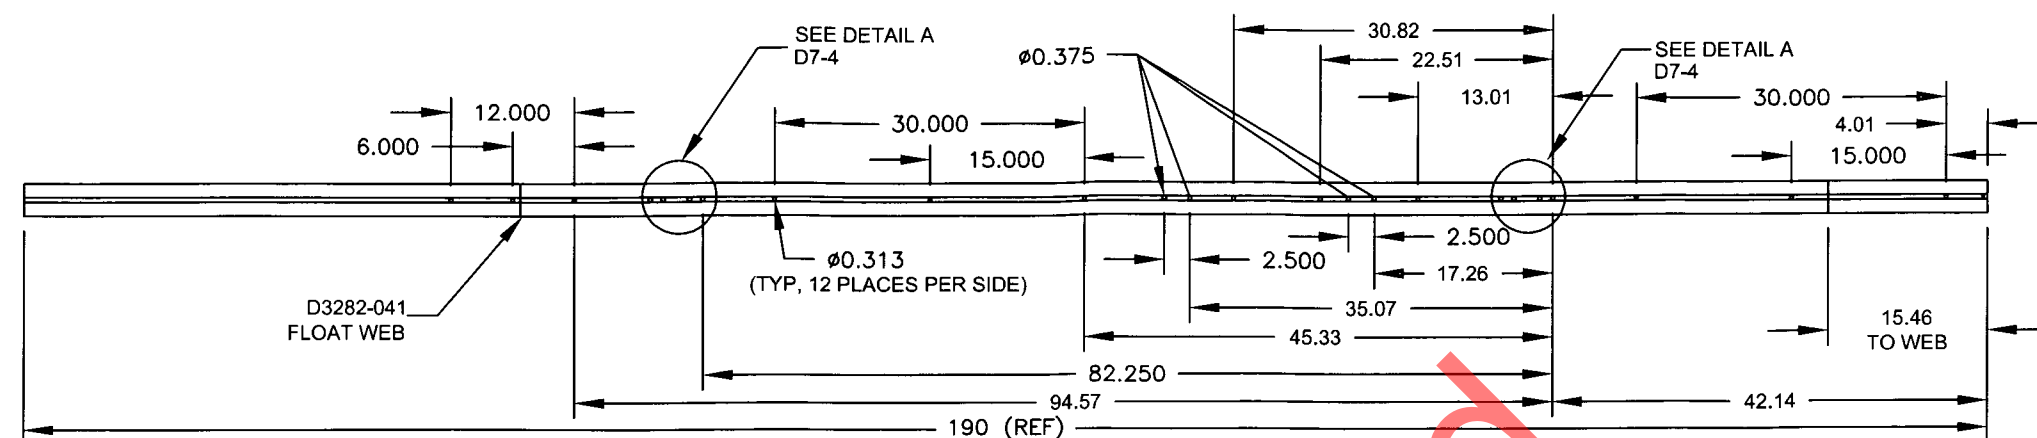

D3274-041 DRILLING/ASSEMBLY DETAIL

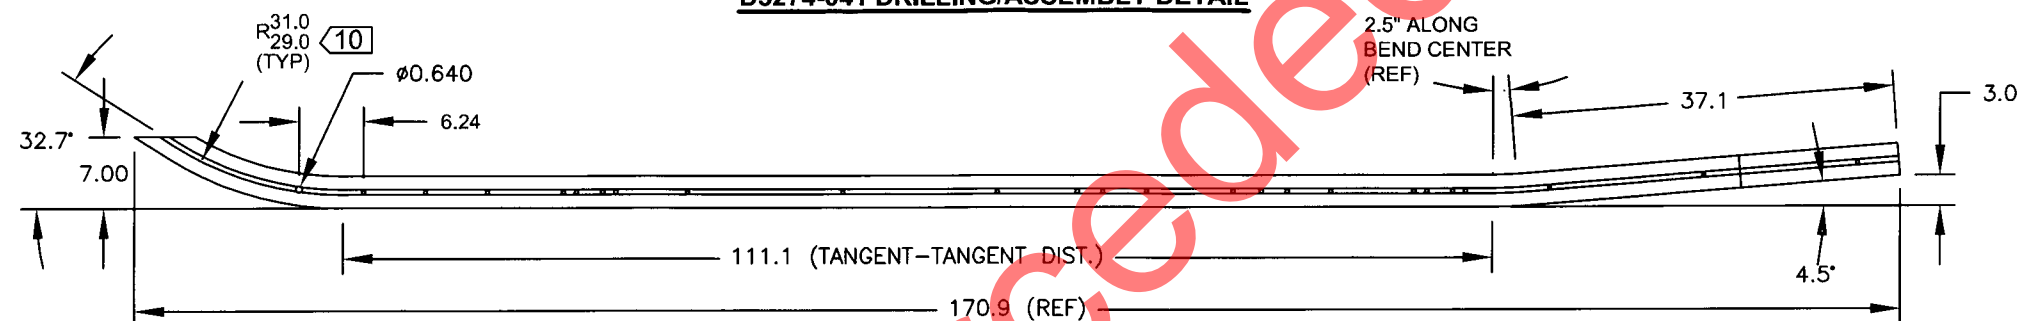

D3274-041 BEND/DRILLING DETAIL

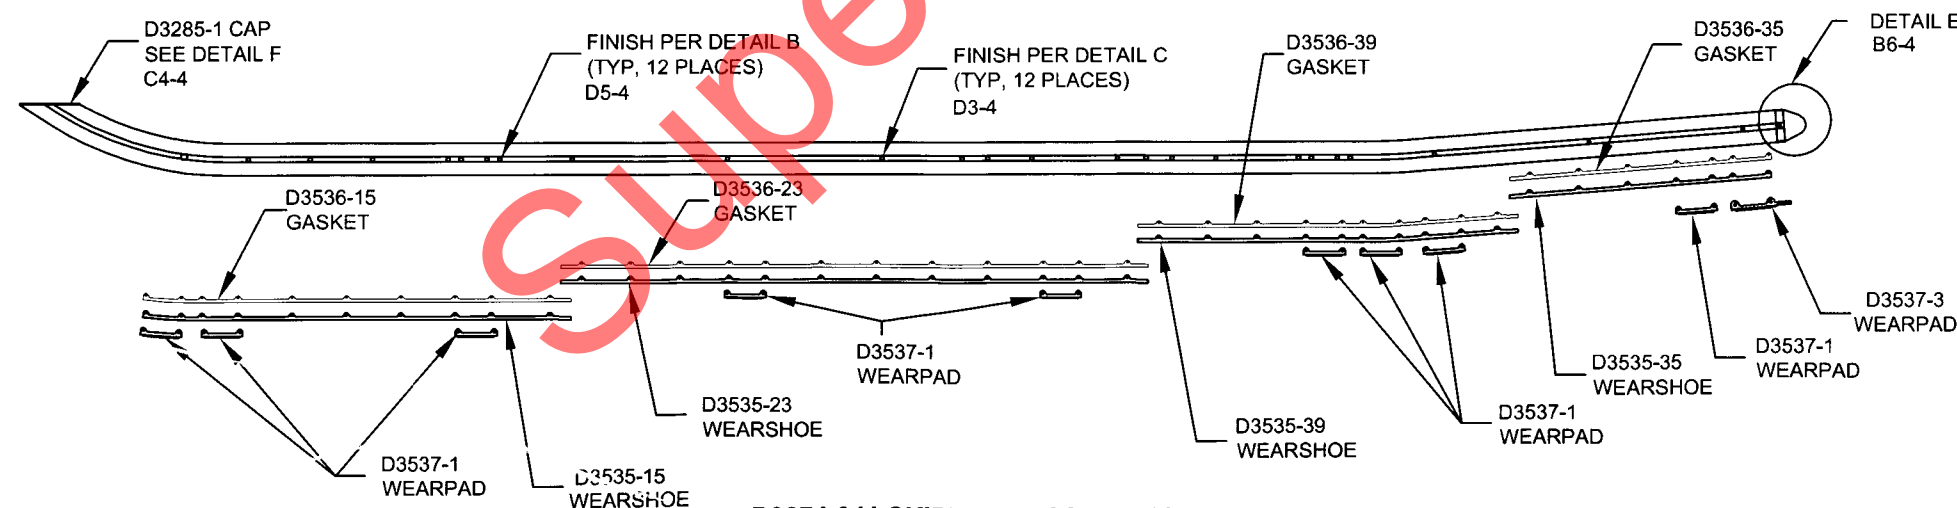


**D3274-041 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)**

RELEASED
47 3/19/14


DESIGN	CP	DART AEROSPACE LTD	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	DD	D3274	SHEET 2 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		SKIDTUBE ASSEMBLY	NTS
DATE	13.05.17	<small>COPYRIGHT © 2004 BY DART AEROSPACE USA, LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, LTD.</small>	

Superceded


REVISED

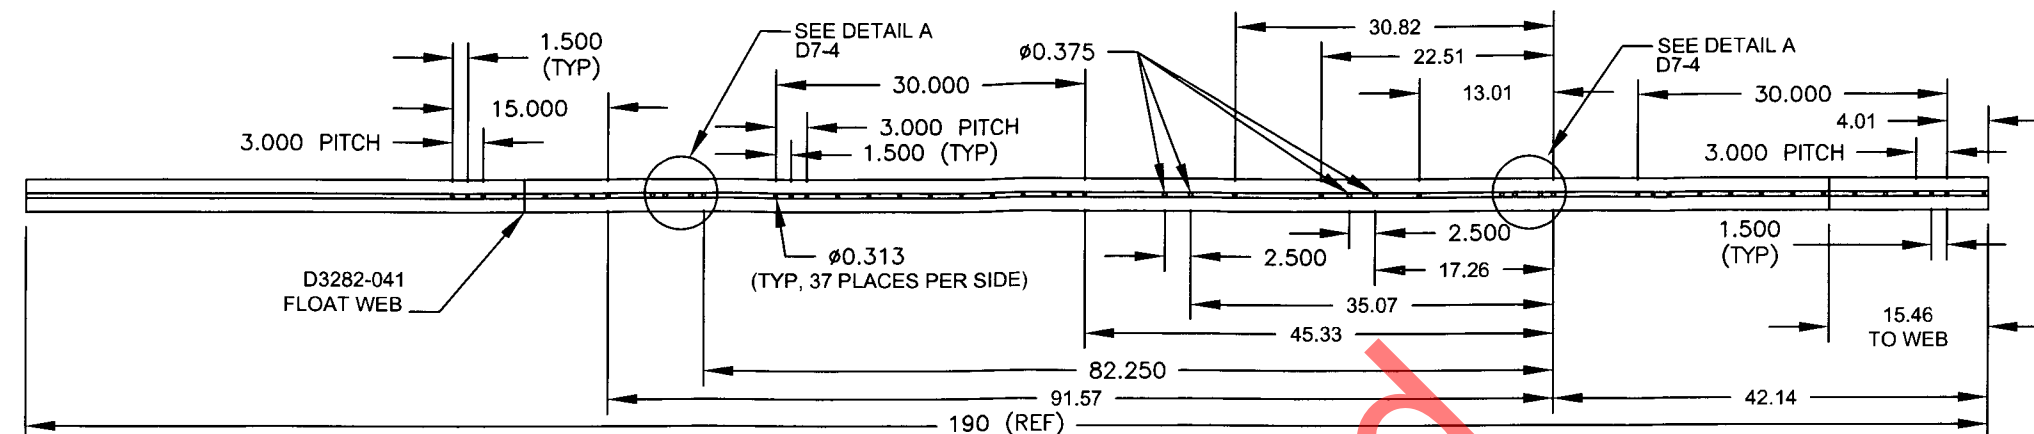

D3274-043 DRILLING/ASSEMBLY DETAIL

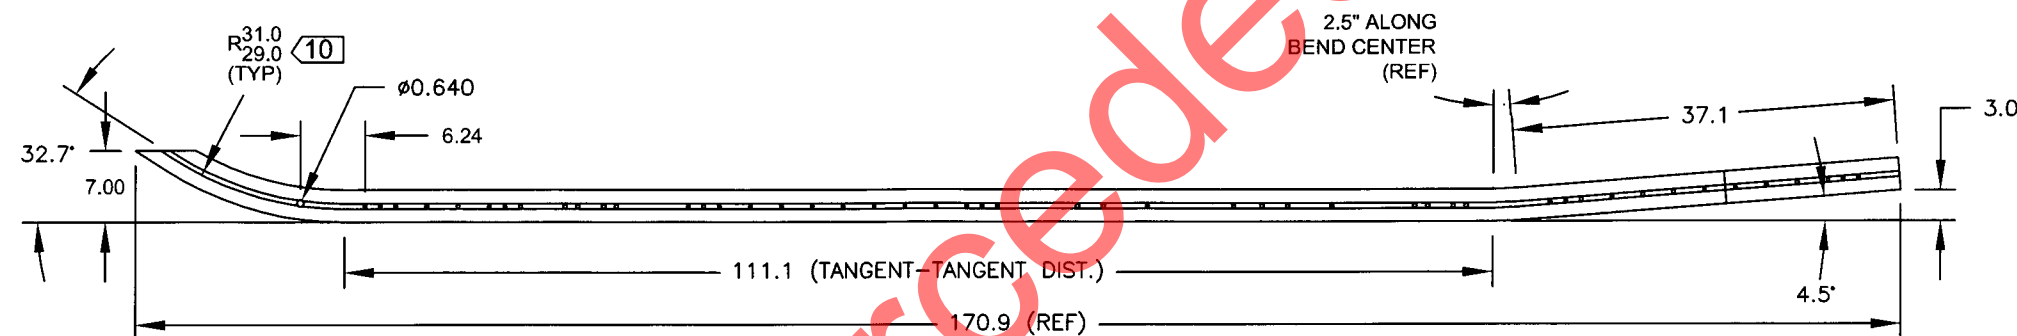

D3274-043 BEND/DRILLING DETAIL

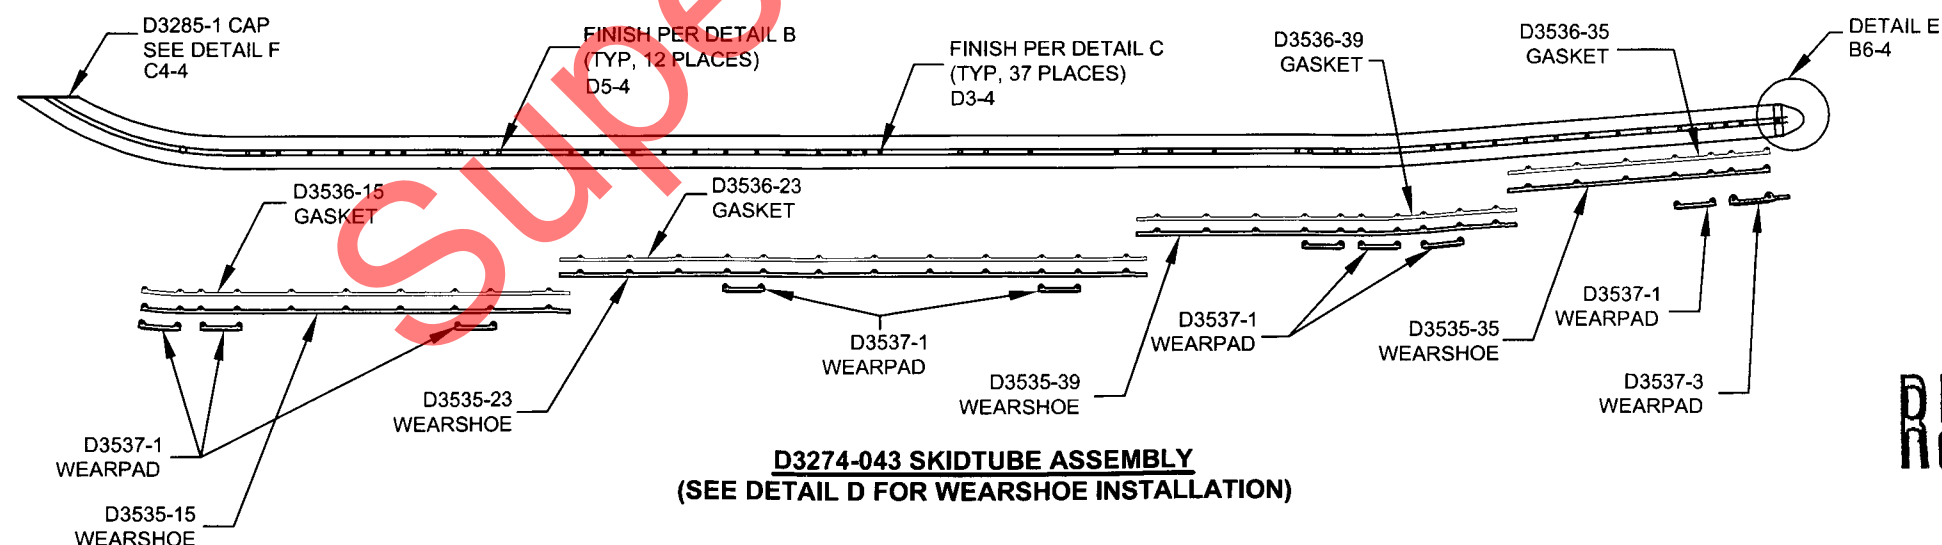


**D3274-043 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)**

RELEASED
13/9/14


DESIGN	CP	DART AEROSPACE LTD	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	DD	D3274	SHEET 3 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		SKIDTUBE ASSEMBLY	NTS
DATE	13.05.17	<small>COPYRIGHT © 2004 BY DART AEROSPACE USA, LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, LTD.</small>	

DETAIL A: DRILL DETAIL
D6-2, D3-2, D5-3, D3-3

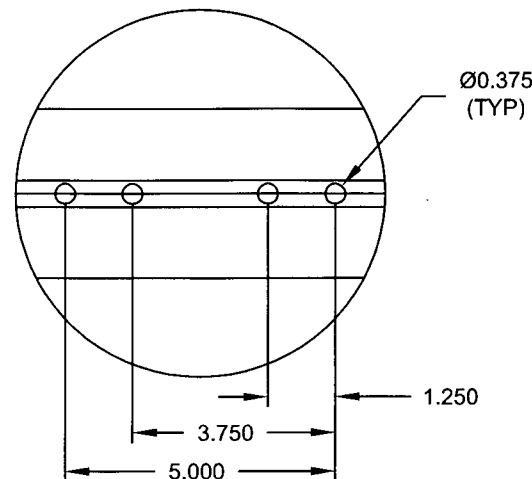

DETAIL B
B6-2, B5-3


FOR Ø0.375 HOLES ONLY

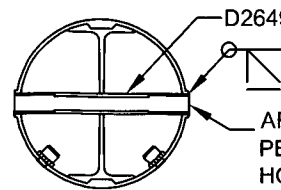

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO Ø0.313x0.75 DEEP


DETAIL C
B5-2, B4-3

FOR Ø0.313 HOLES ONLY

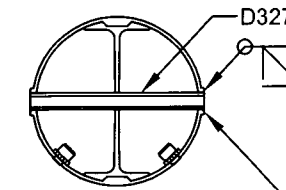

CHAMFER 0.030x45°
(TYP)


DETAIL D
A4-2, A4-3

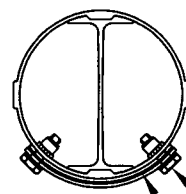

ALS7-1032-130 INSERT (1)
AN3C4A BOLT (1)
AN960C10L WASHER (1)
(78 PLACES)


GASKET/WEARSHOE/WEARPAD (REF)

DETAIL E
B2-2, B2-3

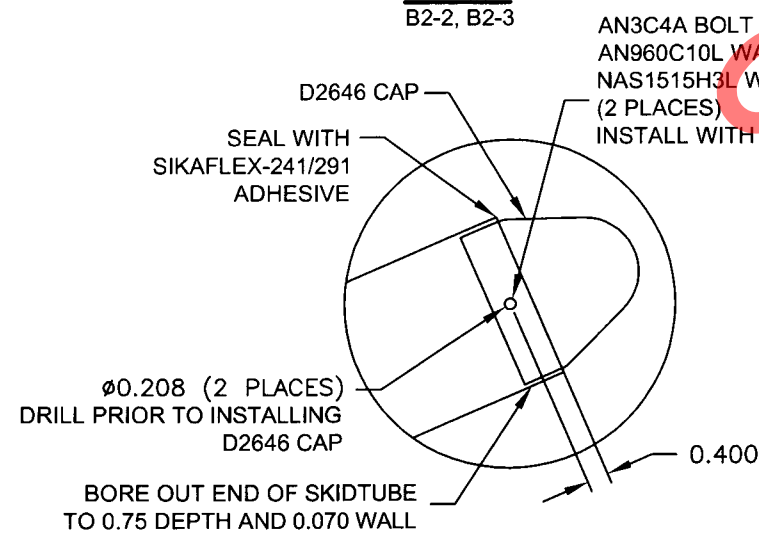

AN3C4A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(2 PLACES)
INSTALL WITH SIKAFLEX-241/-291

DETAIL F: END FINISHING DETAIL
B7-2, B7-3

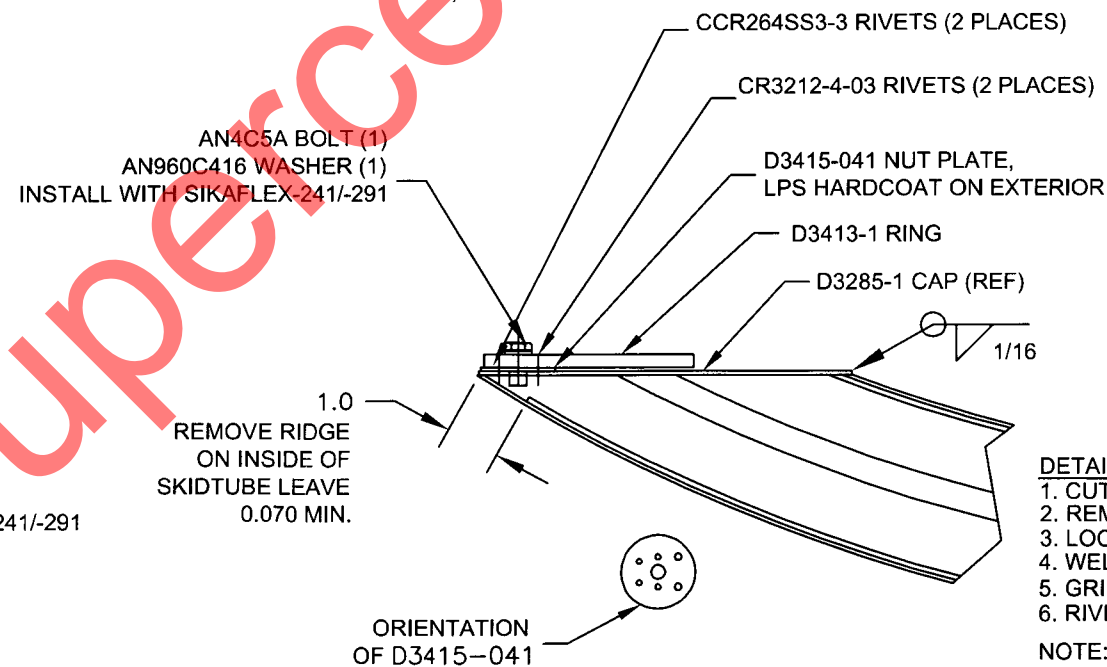

DETAIL F NOTES
1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NECESSARY)
4. WELD D3285-1 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE
NOTE: MASK THREADS IN D3415-041
PRIOR TO FINISH

RELEASED
13/9/14

DESIGN	CP	DART AEROSPACE LTD	
DRAWN	DW	KENT, WA	
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	DD	D3274	SHEET 4 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.		SKIDTUBE ASSEMBLY	NTS
DATE	13.05.17	<small>COPYRIGHT © 2004 BY DART AEROSPACE USA, LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, LTD.</small>	